


THE INFORMATION CONTAINED HEREON IS THE PROPERTY OF EMERSON NETWORK POWER, RECEIPT, POSSESSION OR TRANSMITTAL OF THIS DRAWING DOES NOT LICENSE OR IMPLY ANY RIGHT TO USE, SELL, PROTOTYPE OR MANUFACTURE FROM THIS INFORMATION. NO REPRODUCTIONS OR PUBLICATION OF THIS INFORMATION, IN WHOLE OR IN PART, SHALL BE MADE WITHOUT WRITTEN AUTHORIZATION FROM EMERSON NETWORK POWER.

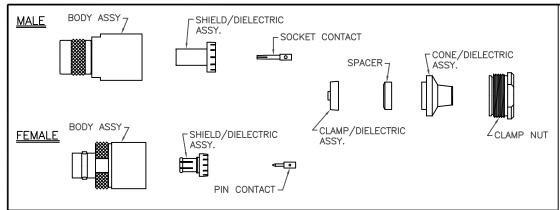

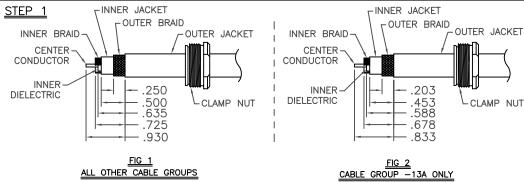



- A. PLACE CLAMP NUT ONTO CABLE AS SHOWN.
- B. BEGINNING WITH A SQUARE CUT, STRIP CABLE AS SHOWN IN FIG. 1 OR FIG. 2, REMOVE WATER BLOCKING IF ANY.
- C. LIGHTLY TIN CONDUCTOR

STEP 2

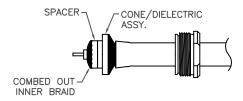


- A. PUSH CONE/DIELECTRIC ASSY. UNDER OUTER BRAID UNTIL BRAID IS FLUSH WITH OUTSIDE DIAMETER OF CONE.
- B. PLACE SPACER OVER INNER JACKET UNTIL SEATED AGAINST CONE/DIELECTRIC ASSY. WITH ANGLED SIDE SPACER FACING AWAY FROM CONE/DIELECTRIC ASSY.
- C. COMB OUT INNER BRAID AND FOLD BACK OVER SPACER AND TRIM INNER BRAID TO BE FLUSH WITH OUTSIDE EDGE OF SPACER IF REQUIRED.

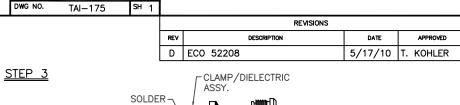

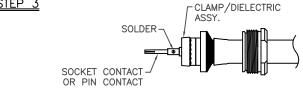


- A. PLACE CLAMP/DIELECTRIC ASSY. (WITH TAPER AS SHOWN) OVER CABLE DIELECTRIC WITH CENTER CONDUCTOR THRU CENTER HOLE UNTIL SEATED AGAINST INNER BRAID.
- B. PLACE SOCKET CONTACT OR PIN OVER CONDUCTOR UNTIL BOTTOMED INSIDE CLAMP/DIELECTRIC ASSY. AND SOLDER IN PLACE.

STEP 4

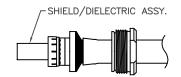

A. INSTALL SHIELD/DIELECTRIC ASSY OVER SOCKET CONTACT OR PIN CONTACT AND CLAMP/DIELECTRIC ASSY. UNTIL BOTTOMED.

STEP 5

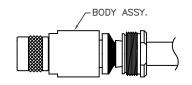

- A. BRING CLAMP NUT UP ONTO TAPERED PORTION OF CABLE.
- B. INSTALL BODY ASSY. OVER ENTIRE ASSY AND ENGAGE WITH CLAMP NUT.
- C. WRENCH TIGHTEN TO 30-40 IN LB TORQUE.

