


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>


COMPU-SHIELD ASSEMBLY INSTRUCTIONS

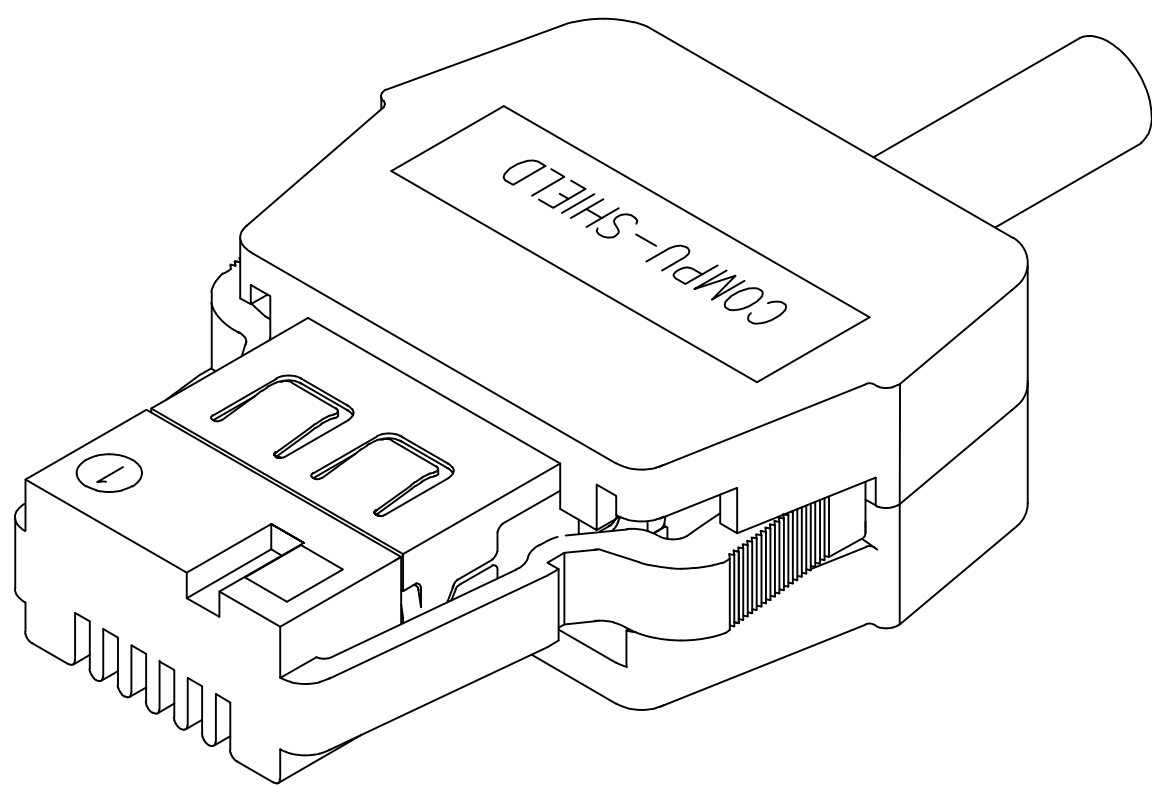

Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

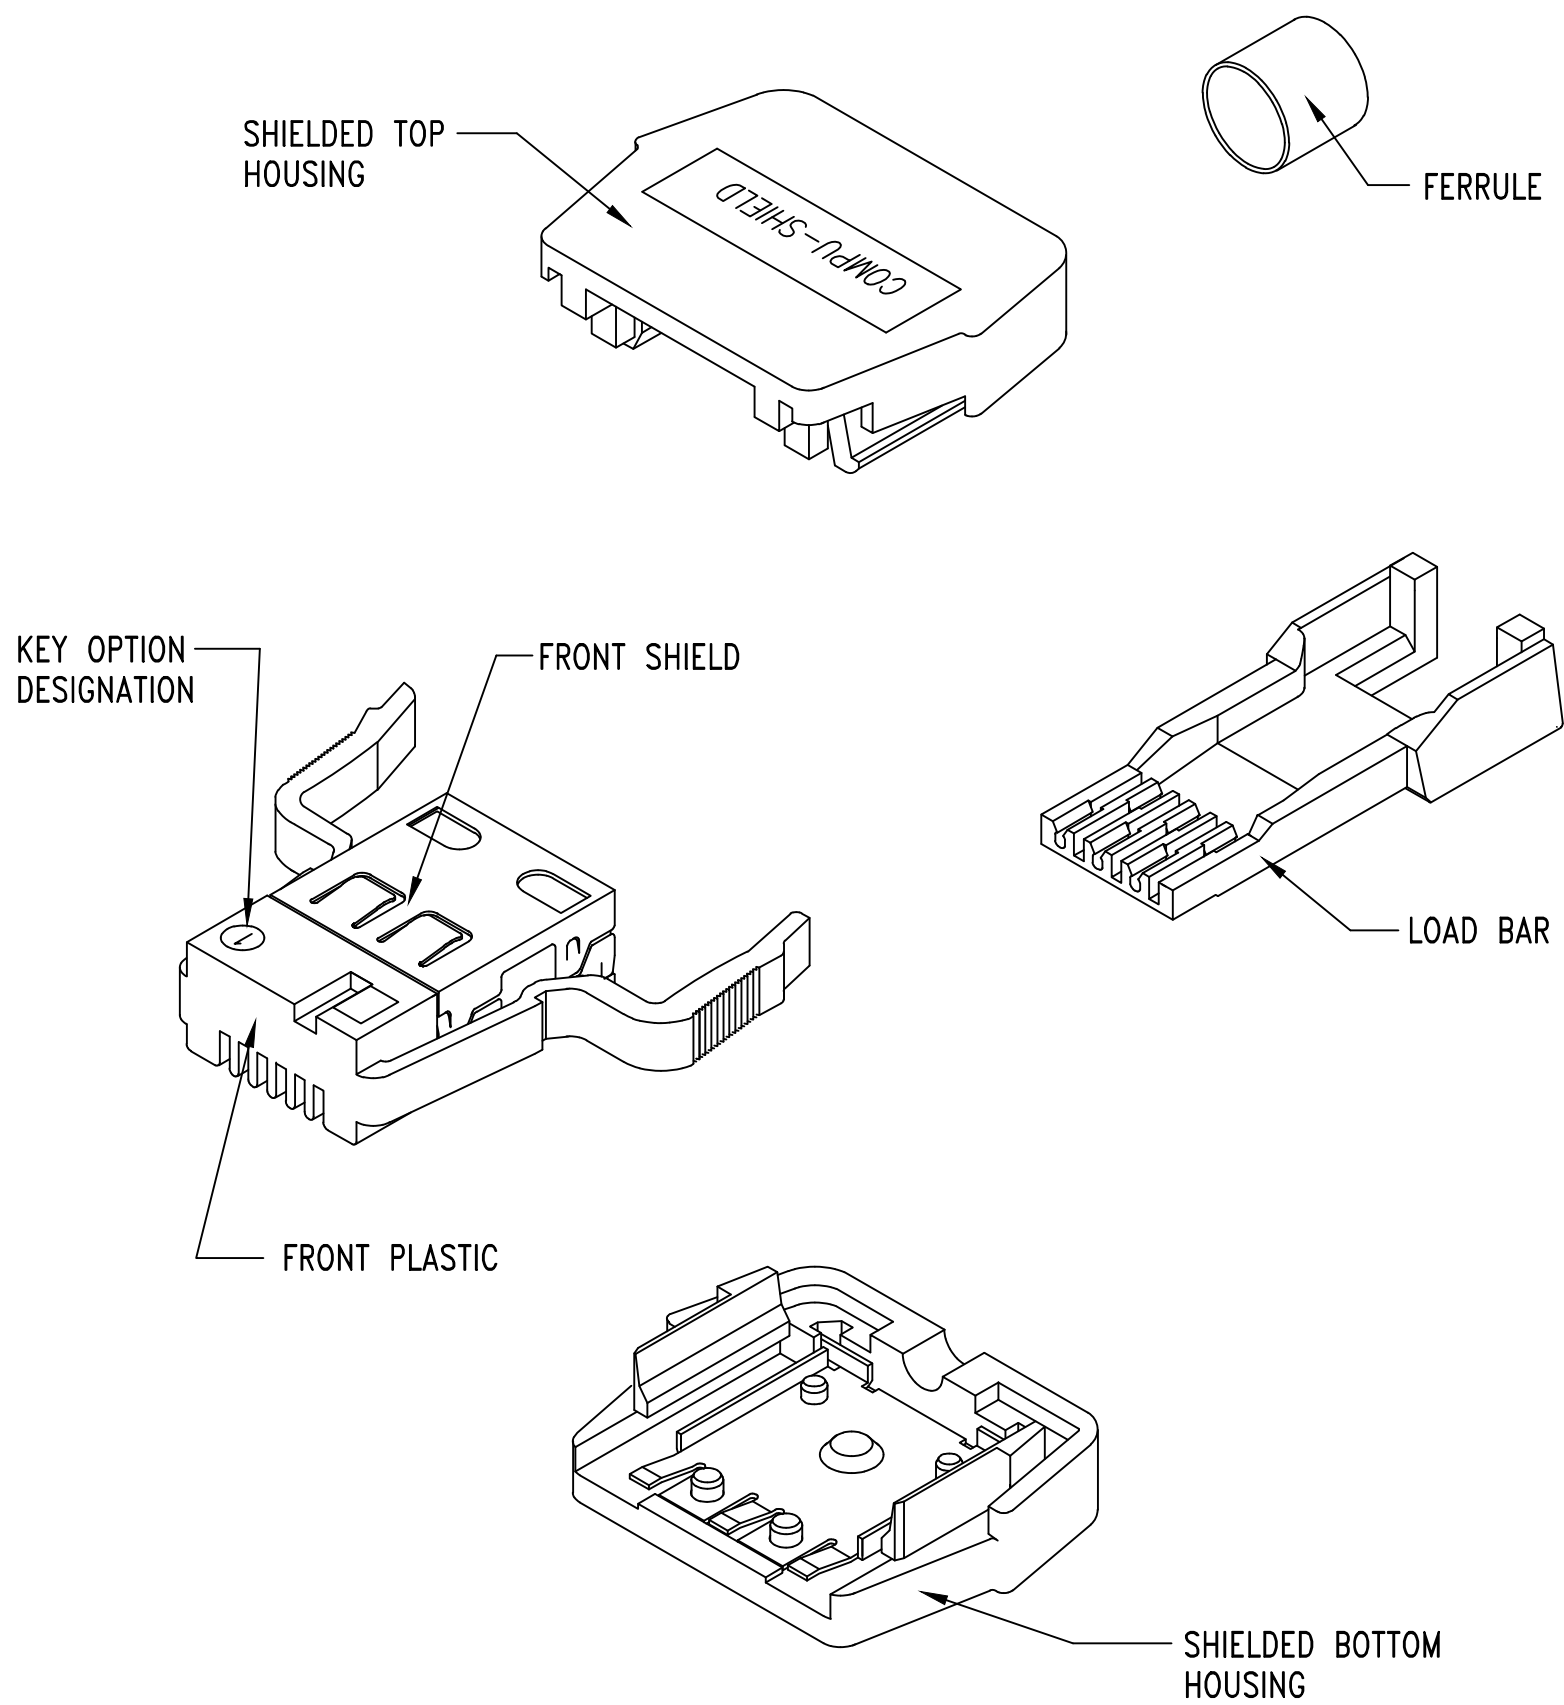


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

- A. CUT CABLE TO DESIRED LENGTH.
- B. TRIM BACK CABLE JACKET TO EXPOSE APPROXIMATELY 2.00-2.50 INCHES [50.80-63.50mm] OF SHIELDED CONDUCTORS.
- C. PEEL BACK SHIELDING OVER CABLE JACKET TO EXPOSE CONDUCTORS.

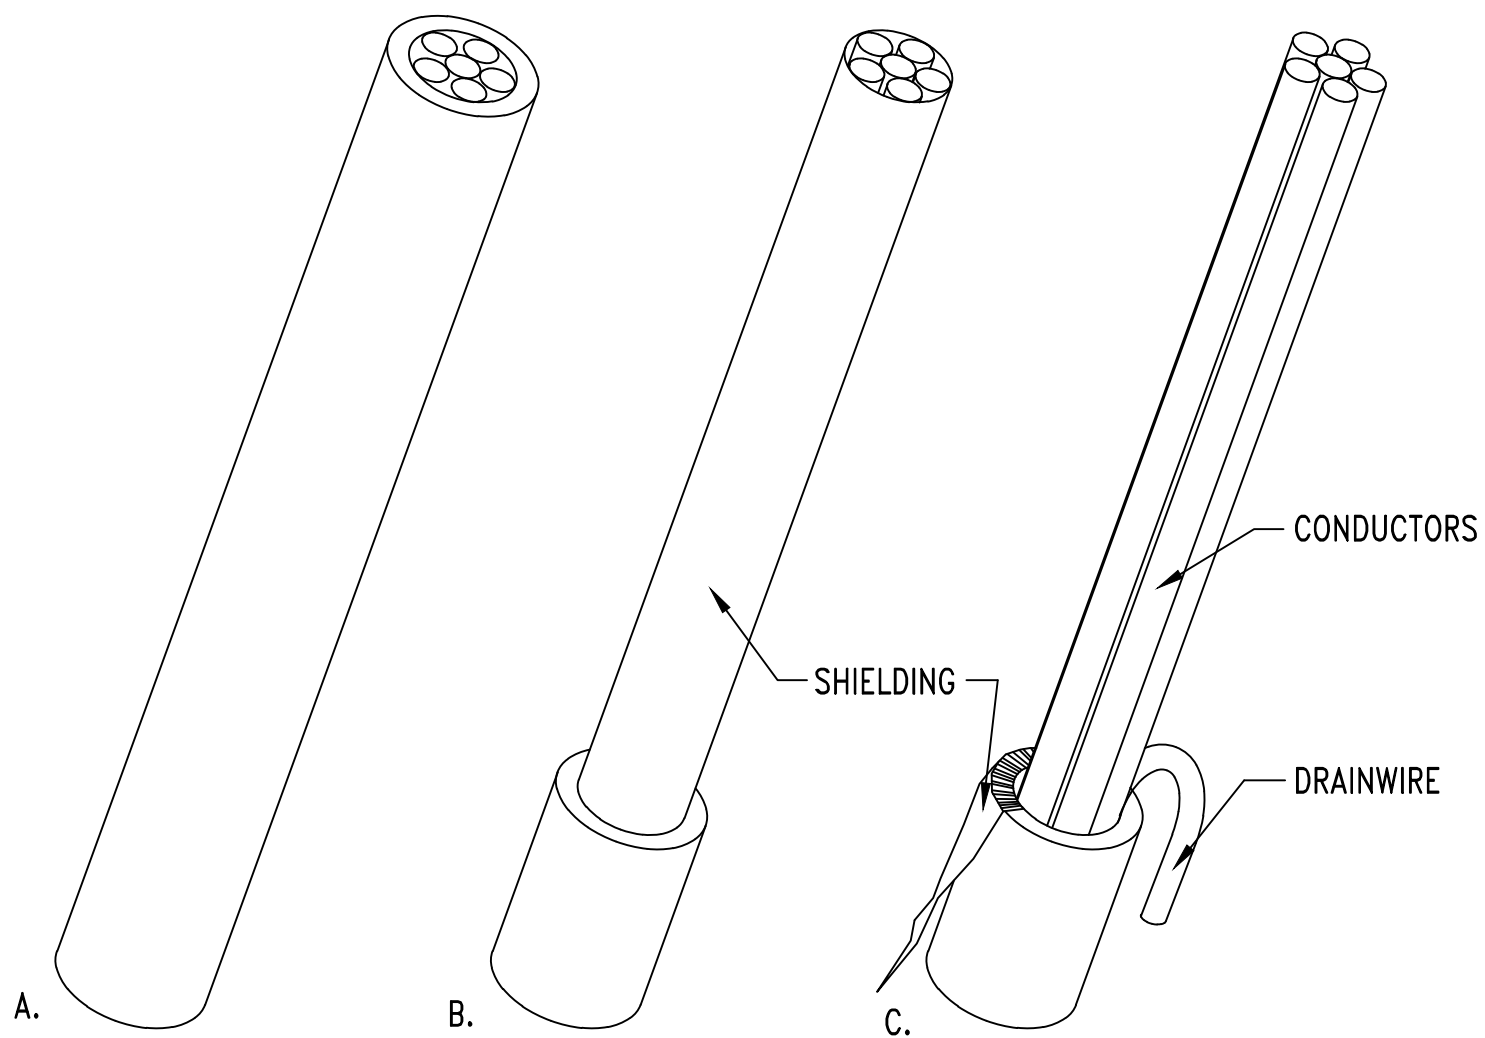


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512


<http://www.stewartconnector.com>

SLIP FERRULE OVER JACKET AND SHIELDING, BEING SURE TO MAKE CONTACT WITH SHIELDING.

NOTE: THE FERRULE'S ROUNDED EDGE GOES TOWARD THE END OF THE CABLE JACKET LEAVING APPROXIMATELY 1/32" OF INSULATION EXPOSED.

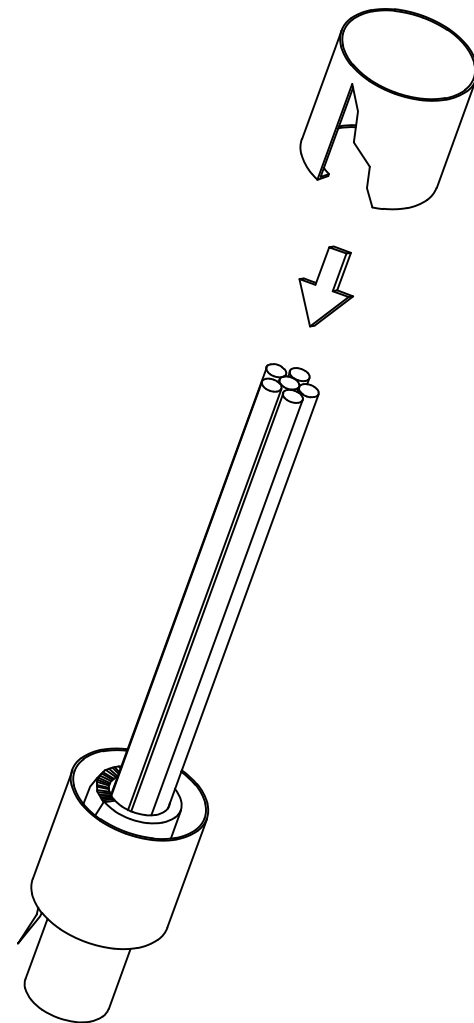

BEFORE CRIMPING FERRULE, IT IS RECOMMENDED, THAT OPERATOR PRE-ARRANGE CONDUCTORS INTO APPROPRIATE TERMINATION SEQUENCE, FOR EASIER POST-CRIMPING ARRANGEMENT.

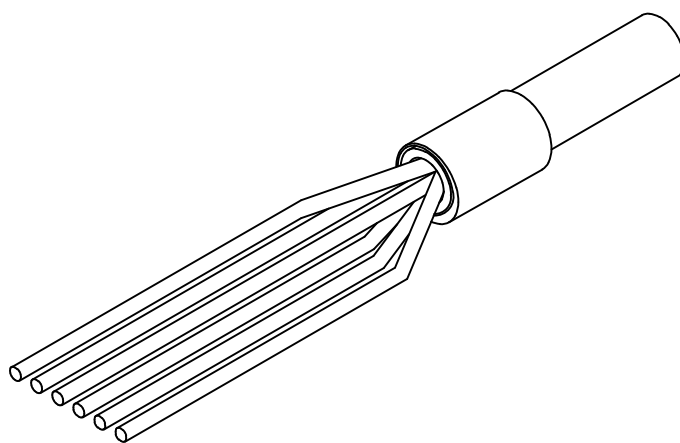


INSERT CABLE, WITH FERRULE, INTO CRIMPING HAND TOOL, WITH APPROPRIATE CRIMP INSERT. CRIMP FERRULE AND TRIM EXCESS SHIELDING AND DRAIN WIRE

Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

FERRULE CRIMPING TOOL

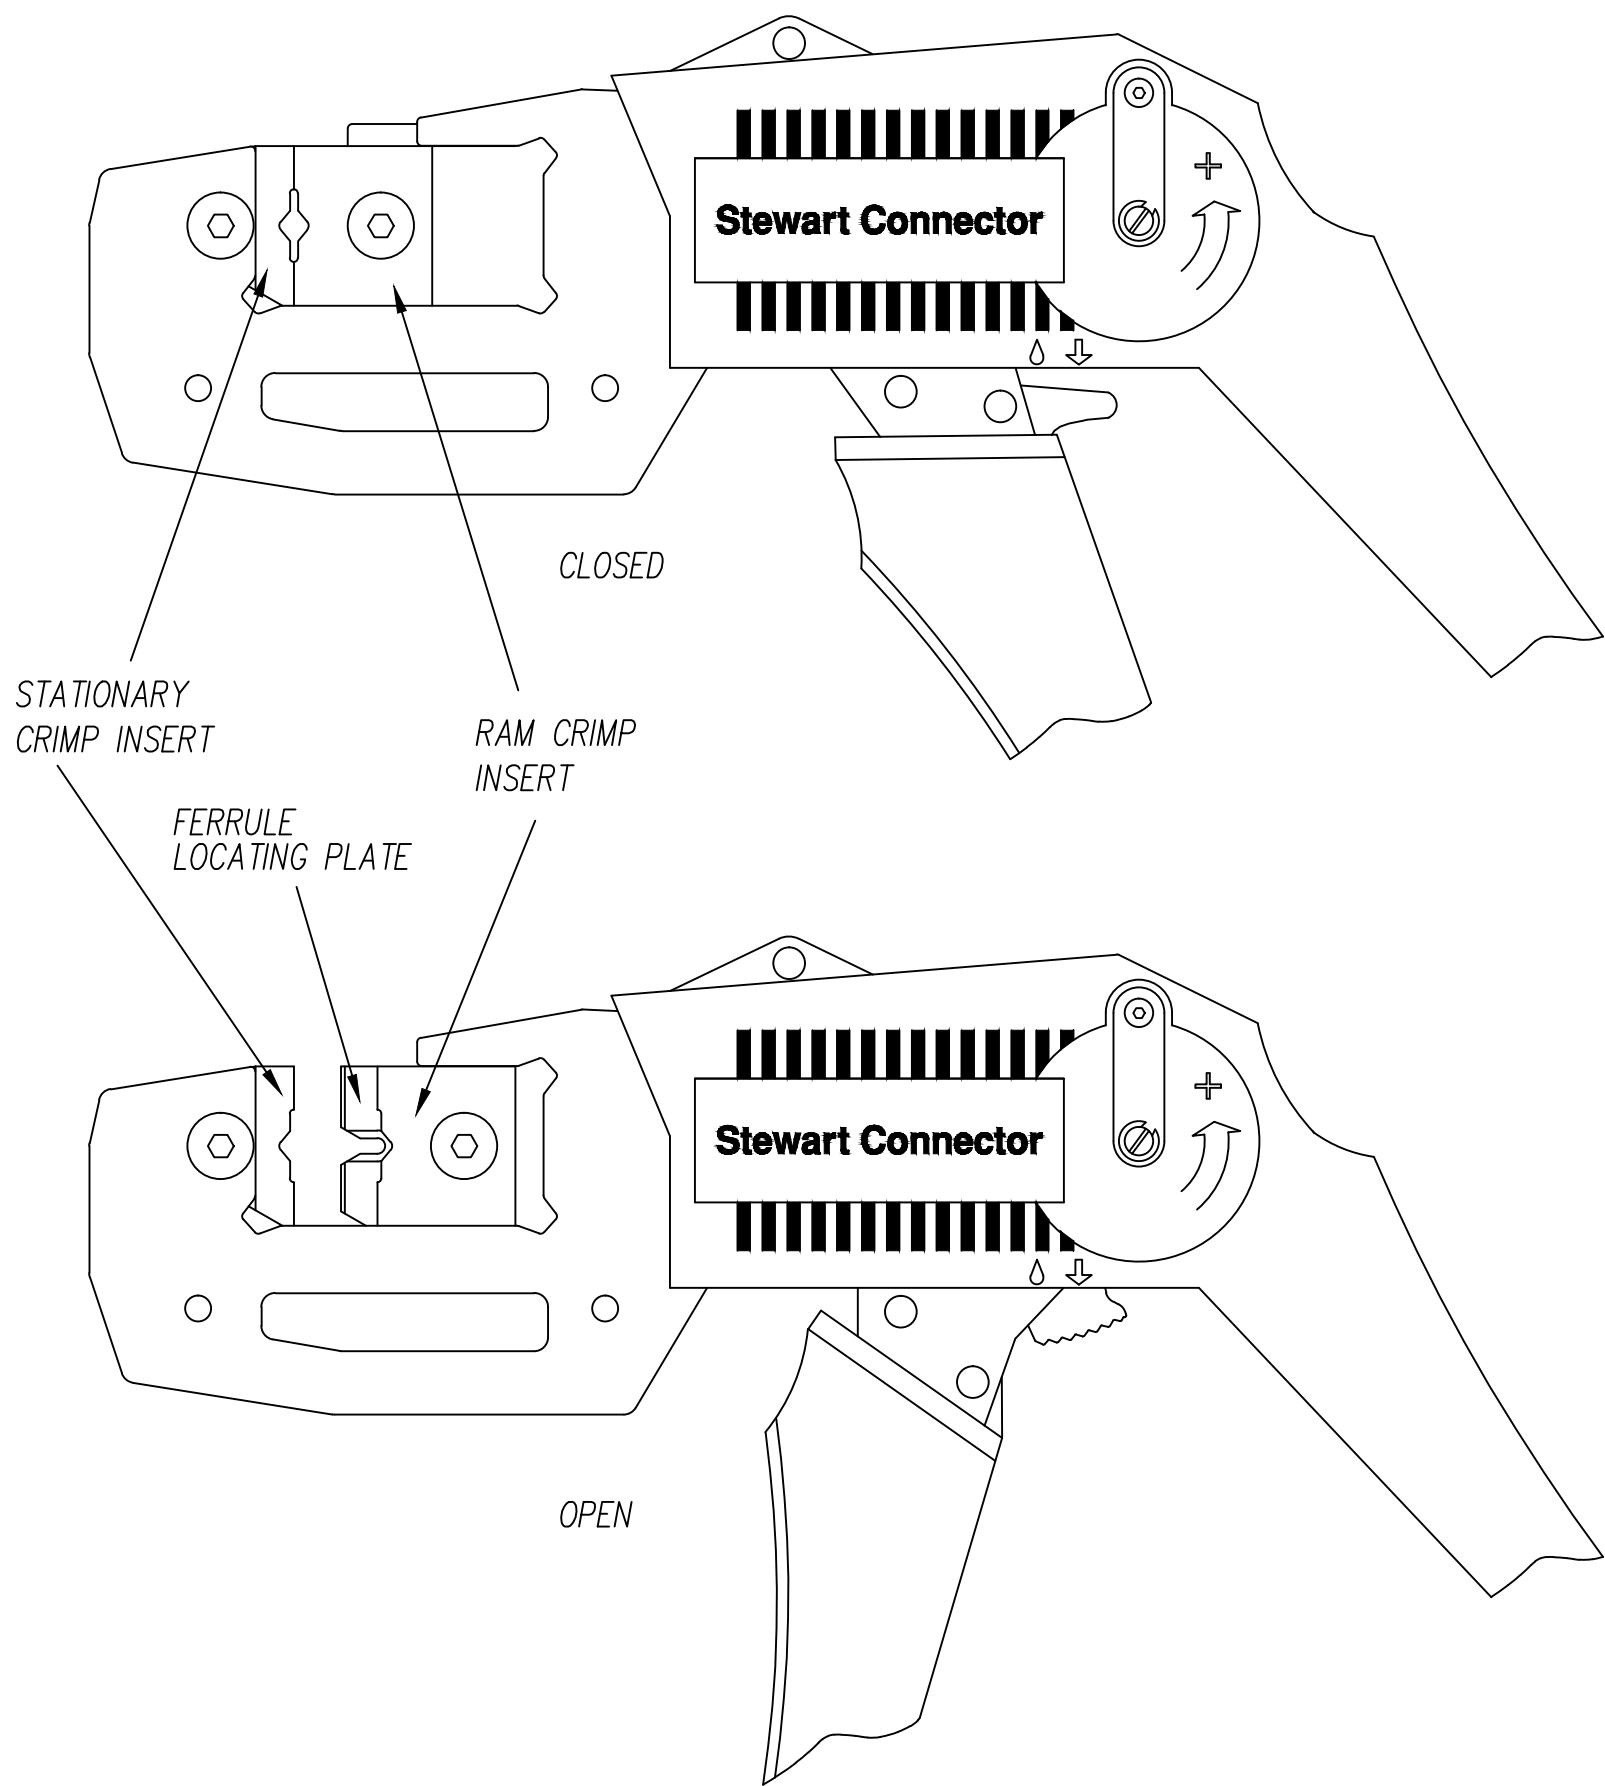


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

ARRANGE CONDUCTORS INTO APPROPRIATE TERMINATION SEQUENCE
AND LAY FERRULE ASSEMBLY INTO LOADBAR.

FERRULE CRIMP HEIGHT = $.190 \pm .010$ (DEPENDENT UPON CABLE TYPE AND SIZE.)

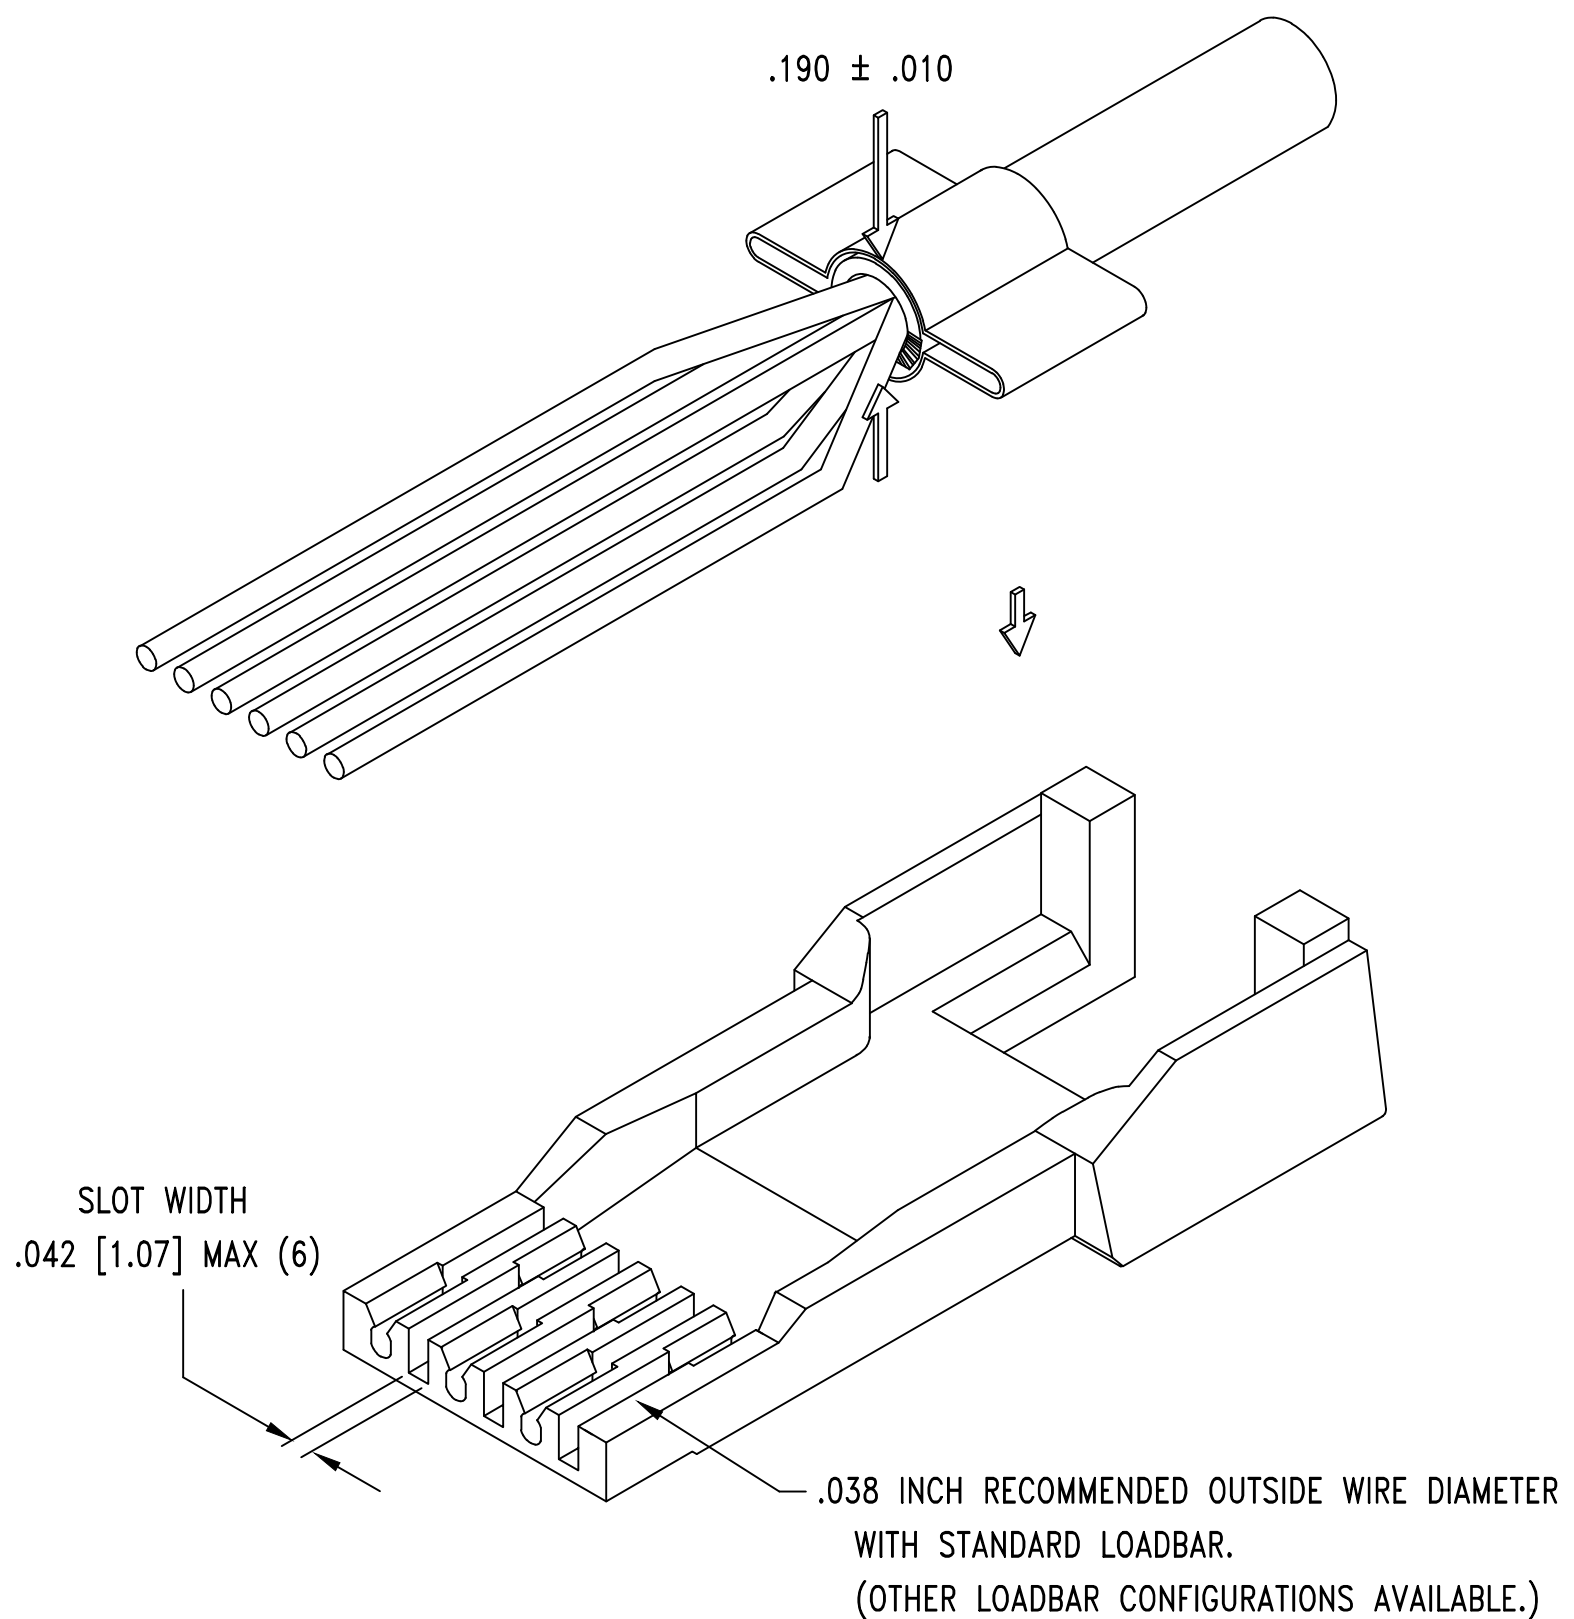


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

SNAP CONDUCTORS INTO PLACE IN LOAD BAR, THEN TRIM AWAY
EXCESS CONDUCTORS EQUAL TO EDGE OF LOAD BAR.

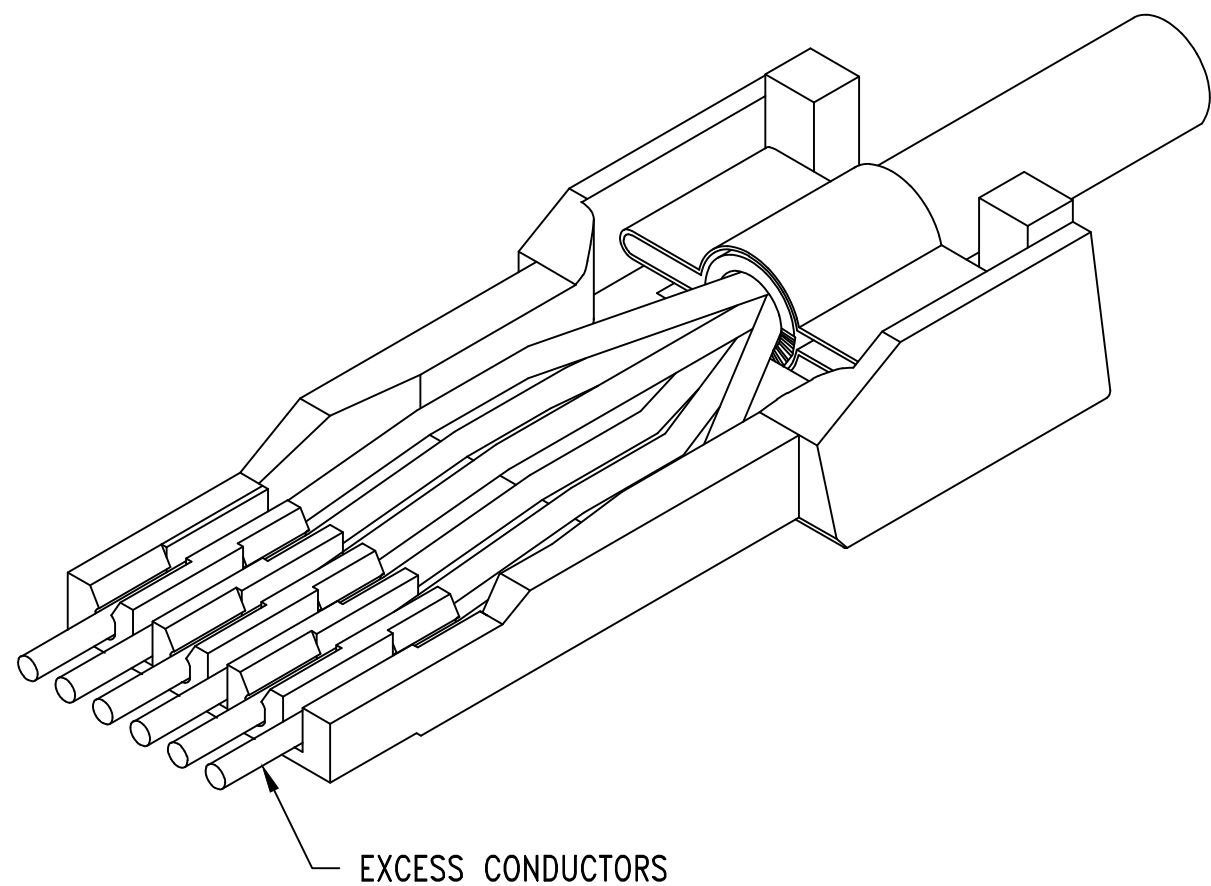


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

- 1.) INSERT LOAD BAR WITH CONDUCTORS AND FERRULE INTO REAR OF PLUG.
- 2.) WHEN FINISHED ASSEMBLING INSERT ASSEMBLY INTO TERMINATION HAND TOOL WITH APPROPRIATE DIE-SET AND TERMINATE.


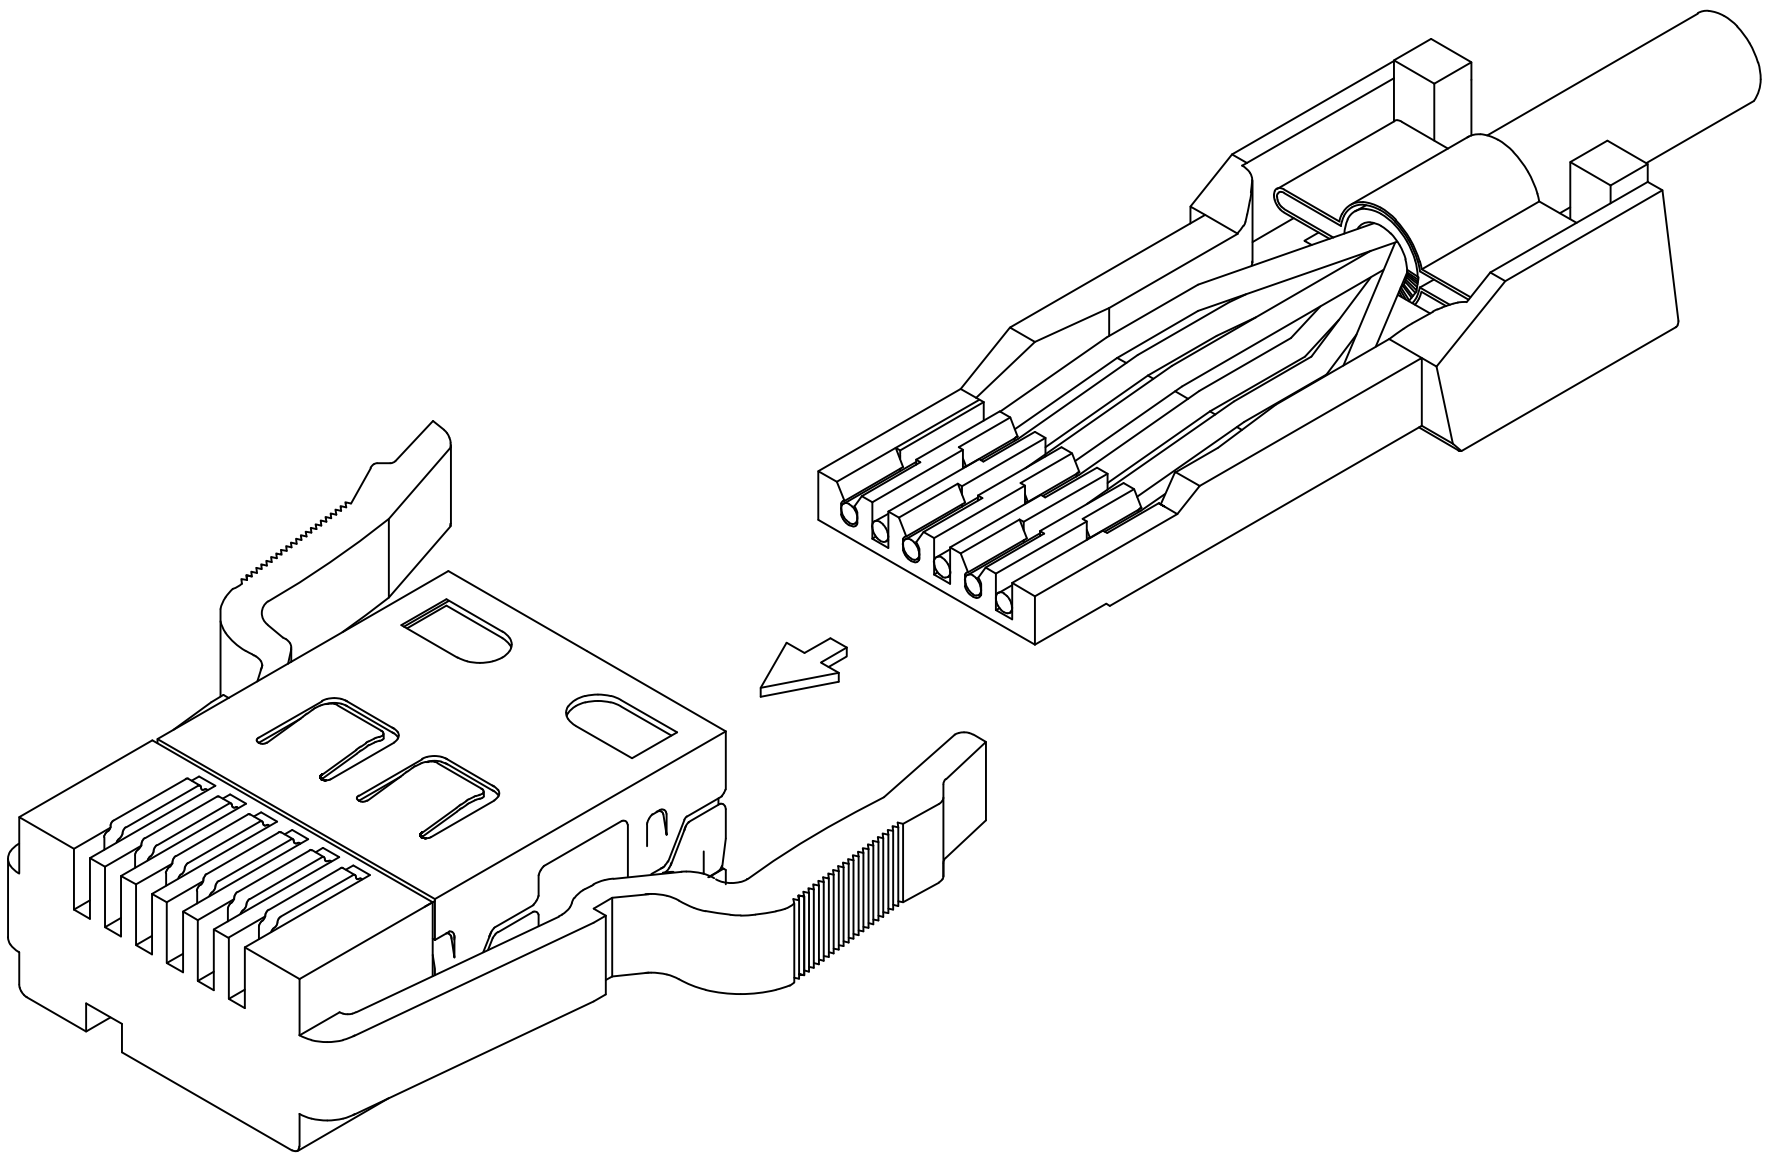


Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

TERMINATION TOOL

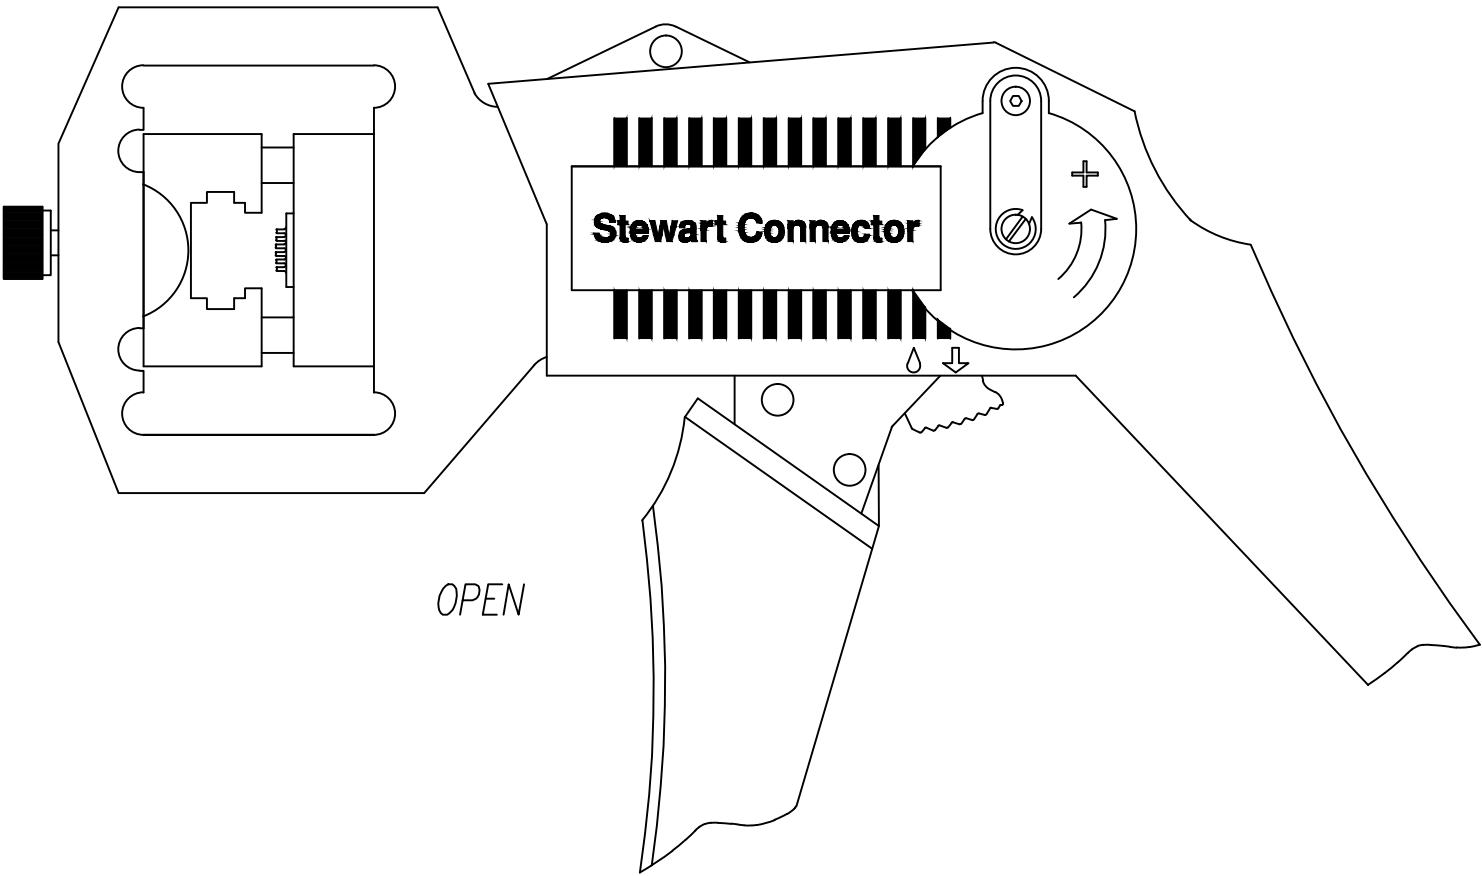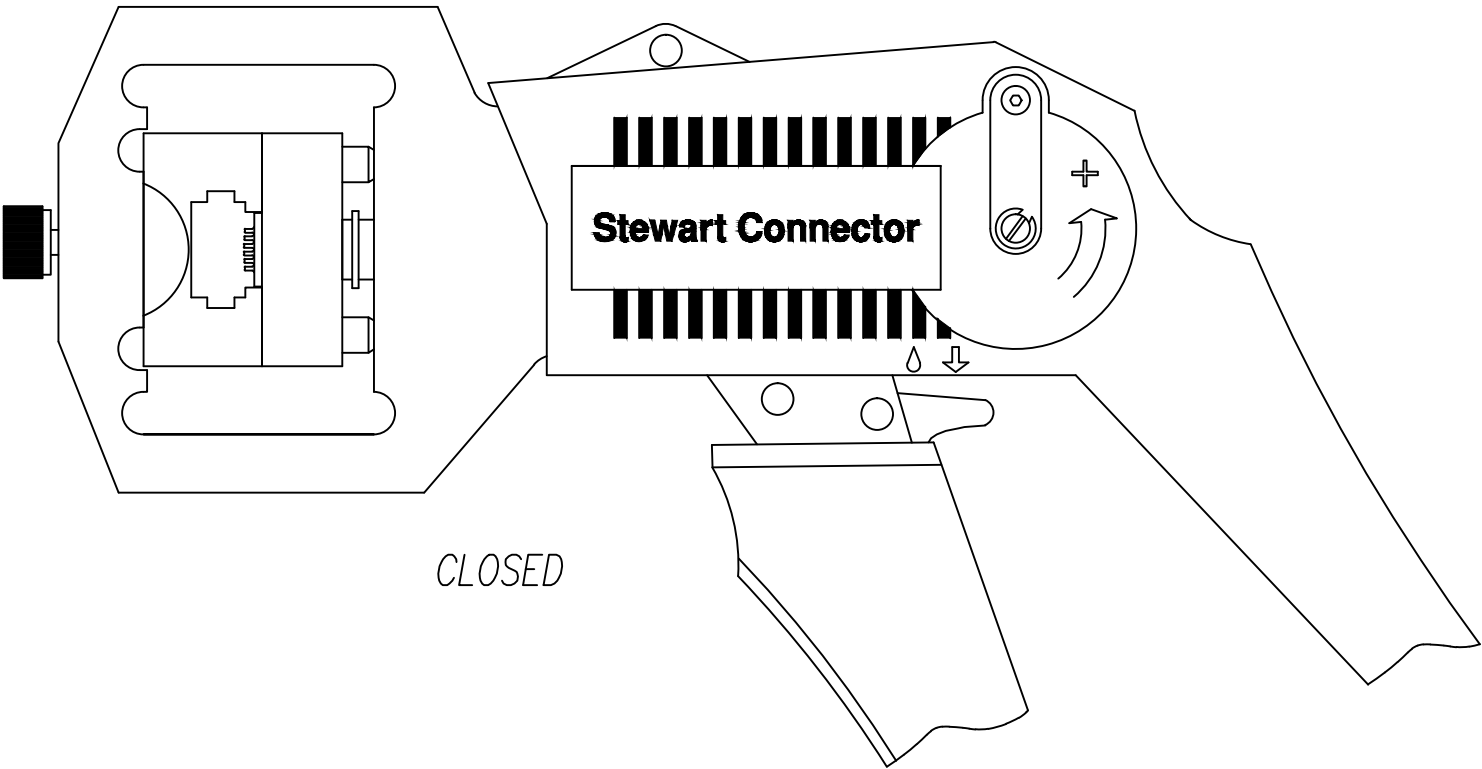



Stewart Connector

11118 Susquehanna Trail South
Glen Rock, PA 17327-9199
(717) 235-7512

<http://www.stewartconnector.com>

AFTER CONTACTS HAVE BEEN TERMINATED, PLACE BODY INTO
SHIELDED TOP PLASTIC, AS SHOWN BELOW.

FINALLY, SNAP SHIELDED BOTTOM PLASTIC ONTO ASSEMBLY.

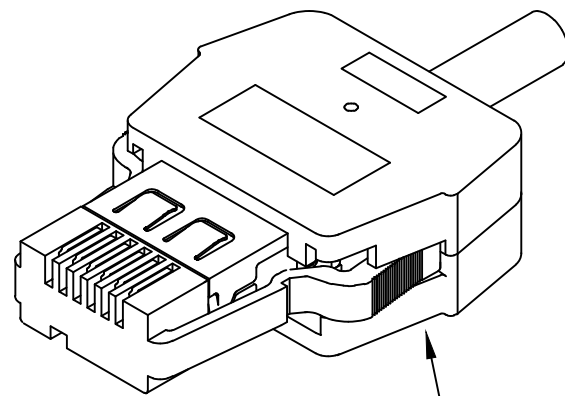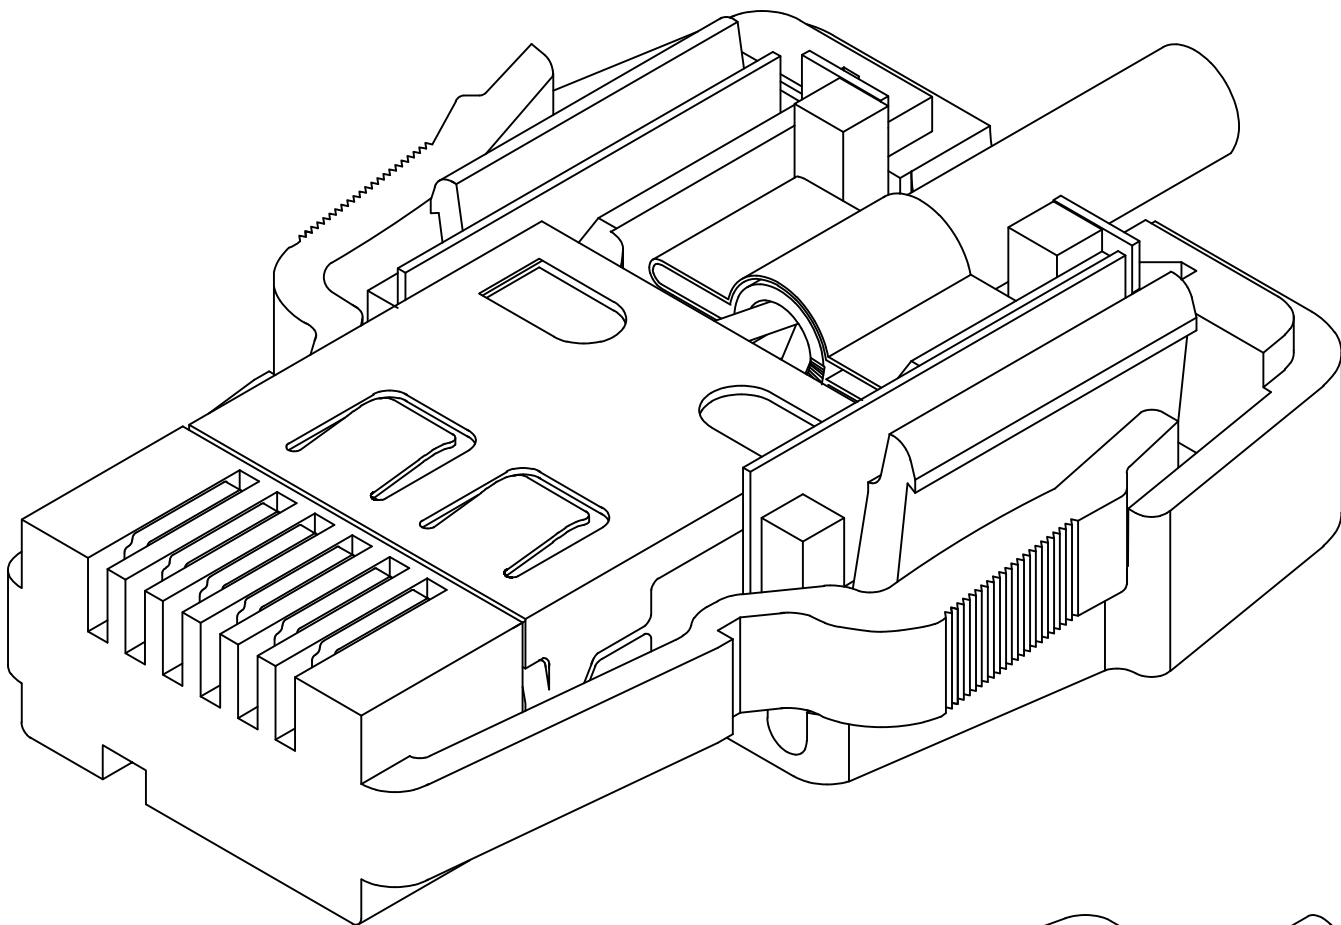

FINAL ASSEMBLY