

Instruction MN770002 Rev. A0 for SS-77100-015

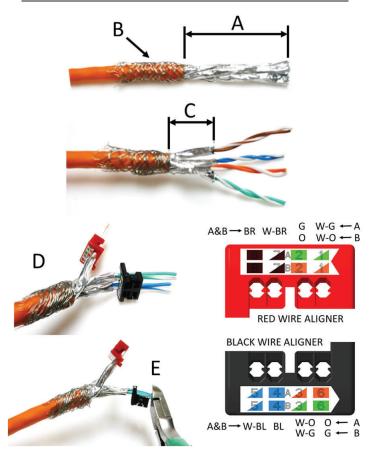

- A) Remove ~50 mm (2 inches) of cable jacket.
- B) Pull the braid back over the cable jacket.
- C) Separate the wire pairs and trim the foil shields, leaving ~23 mm (0.9 inches) of foil present.
- D) Insert the wires into the wire aligners, keeping twists and foil shields as close as possible to the plastic. Part can be wired for 568 A or B as shown.
- E) Trim off excess wire.

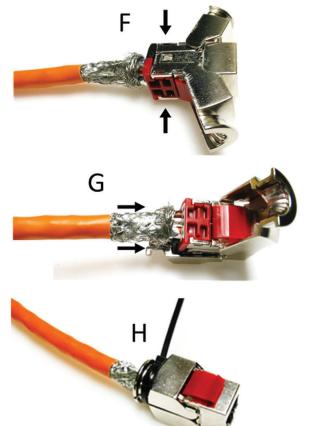

- F) Slide wire aligners onto jack as shown – make sure the red wire aligner is on the same side as the red panel latch. Seat wire aligners with pliers if necessary.
- G) Push braid back over foils against wire aligners – make sure no stray braid strands enter wire holes.
- H) Close metal flaps over the braid and secure with the zip tie. Assembly is complete, test as required.

